


191/1800XX/A DLM-2.1 BASIS wiring diagram



CONNECTOR A Wiring Loom Part Number : 191/180001/A

PIN	Wire text	Wire color	PIN	Wire text	Wire color
1	GROUND BATTERY	brown	18	AD1	blue-white
2	+12V BOOST PUMP RELAY	red-white	19	AD4	blue
3	+12V FUEL SWITCH	red-white	20	AD3	blue-pink
4	+12V BATTERY (fused)	red-white	21	AD9	red-white
5	-	-	22	LSS1	purple
6	-	-	23	LSS2	purple-green
7	IGNITION	grey-white	24	+12V LOCK-OFF FSU	yellow-green
8	RPM ENGINE SPEED	purple-white	25	DAC1	green-white
9	+5V SENSOR	red-blue	26	GROUND BOOST PUMP RELAY	brown-black
10	DAC2	green	27	-	44 -
11	+ TANK LEVEL SUPPLY	blue	28	-	45 -
12	TANK LEVEL IN	red	29	-	46 RS232 TXD
13	+12V BATTERY SENSE	red	30	-	47 -
14	-	-	31	C GROUND	brown-black
15	T-ECT	grey	32	GROUND BATTERY SENSE	brown-black
16	PSYS	green	33	GROUND TANK LEVEL	brown-black
17	AD2	blue-green	34	C GROUND	brown-black

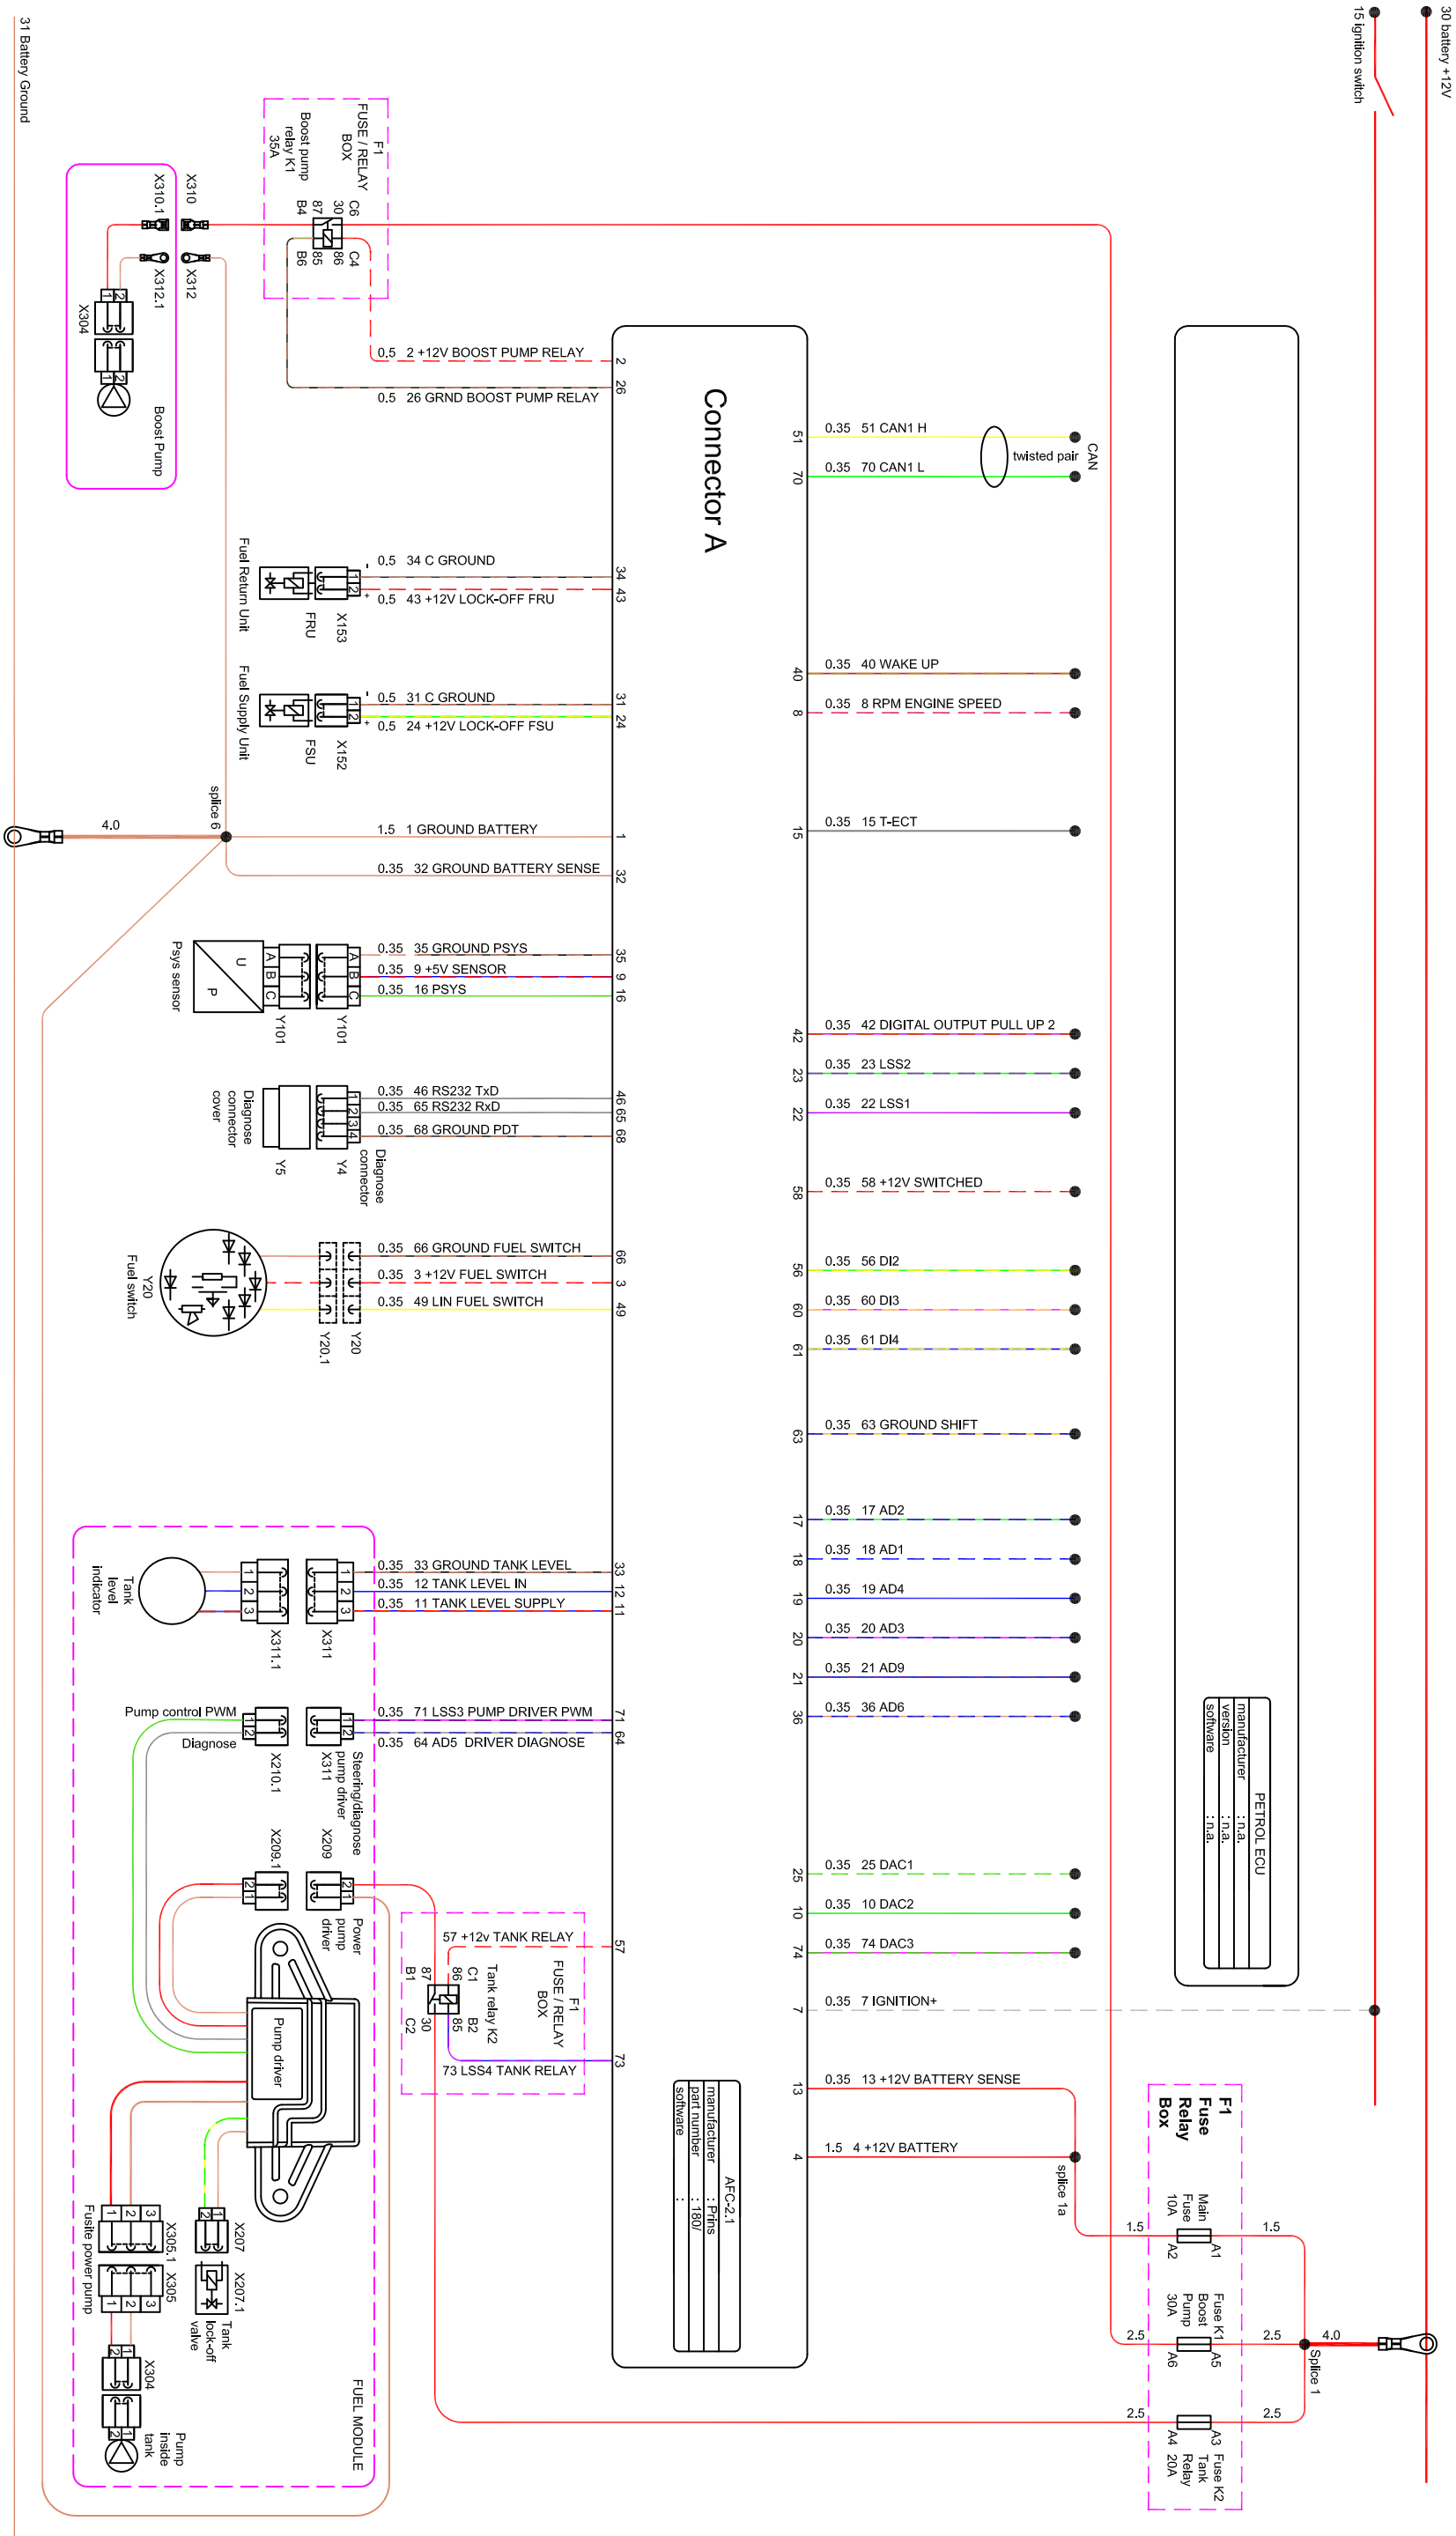